



SC-100 Field Calibration

Questions?

Call: (951) 354-1800

VR31 "master" or inside

VR26 gooseneck dominance.

DO NOT ADJUST! CONSULT THE FACTORY PRIOR TO ADJUST-MENT.

VR131 remote/outside

Symptom: conversation is "clipped"; conversations are cut short.

Solution: FIRST: NOTE ORIGINAL POSITION OF THE POTENTIOMETERS.

if inside operator's (IO)conversation is clipped, increase IO's microphone

sensitivity by turning R31 one (1) notch clockwise.

if outside operator's (OO) conversation is clipped, increase OO's microphone sensitivity by turning R131 one (1) notch clockwise.

Repeat if necessary.

NOTE: R31 and R131 are "balanced". Therefore, decreasing one microphone will have the same effect as increasing the other (it's all relative).

The control assembly must be placed back into the housing to perform correctly. Otherwise, feedback may occur.

"Inside Operator": gooseneck side (SC-100; SC-300); or circuit board side.

VR26 if adjusted clockwise, will allow the gooseneck/master side mic to dominate the outside microphone. If increased too much, the outside/remote will not be heard at all. Default position is at the 10:00 position